

Additional Funding Request
INVOICE

VA006	CSS# 28927 WO# 13647 Asset# NA							
Description of Repairs	Closing for incurred costs.							
Diagnosis: Initial Work Order	There are 5 Pole lights and a building mounted light out							
Diagnostic Fee	\$ 0							
Additional Labor Cost to Perform Repairs	\$ 780.00 Labor \$120/ hr x 6.5							
Additional Cost	\$ 0 <table border="1" style="width: 100%;"><tr><td style="width: 25%;">N/A</td><td style="width: 25%;">1</td><td style="width: 25%;"></td><td style="width: 25%;"></td></tr></table>				N/A	1		
N/A	1							
Total Cost of Repair	\$ 780							



P.O. Box 119 • Altavista, VA 24517 • 24 Hour Service: 800.789.7199 • Fax: 888.722.2712 • MooresElectric.com

Proposal

June 7, 2021

Quotes are valid for 30 days.

USARC - VA006
1634 Cherry Ave Charlottesville VA 22903
PO: CSS 28927 WO 13647
Email ilopy@tideh2o.net & Mary.Lowery@tide

Contact Name Mary Lowery & Adam Colopy
Telephone 0.00
Cell Phone 614-623-9569
Fax Number 0.00

DESCRIPTION OF EQUIPMENT:

Electrical Services

DESCRIPTION OF REPAIRS:

**THIS IS AN AFTER THE FACT PROPOSAL. SERVICE HAS BEEN PERFORMED AND IS NOW COMPLETE. **

4/22/21- Investigated the 5 pole lights and one wall pack that are not working. There are only 5 poles on site. They are controlled by a contactor in the electric room that is controlled by a photocell on the roof. Found that the photocell and contactor are working properly and sending voltage to the site lights. They are 208V, circuit 9, panel P. Have replaced 3 of the 5 heads. 2 of the 3 are working properly. The 3rd (that is outside the fence, near the gate page station) has lost a phase in the ground. Attempted to pull the bad wire out and had no success. The feed is running under the main driveway and suspect that the conduit is crushed due to traffic. The 2 original heads also have photocells that are working but weak. Found that the general state of the whole system is in bad shape. The contactor is old and is showing signs of heat damage. The photocells are clicking open and closed but sounding very weak. The poles have extreme pitting rust damage and have the feed wires hanging out of the hand holes with split bolts that are so large they do not fit into the hand holes. The wires are showing signs of UV/weather damage. Will submit quote to fix issue.

MATERIAL, EQUIP OR PARTS

	Quantity	Sell price
Material Total	\$	-

LABOR ITEMIZED

Labor - Incurred	6.5	\$ 120.00	\$ 780.00
		Labor Total	\$ 780.00

Thank you for your business. If you have any questions or concerns, please feel free to contact us via telephone or quotes@mooreselectric.com

Materials	\$	-
Labor	\$	780.00
TOTAL	\$	780.00

Robert Lowery, Changeout Estimator 434-309-2591
Ian Harris, Estimator 434-309-2497
James Davis, Estimator 434-309-2568
Marvin Slaughter, Estimator 434-369-3514
Jared Underwood, Estimator 434-306-2446

Approved by: _____

Standard Terms and Conditions

Payments past 30 days are subject to 1.5% monthly service charge on unpaid balance. Additional charges for payments made through credit cards may apply. Late payments sent to collections or legal process the purchaser agrees to pay all costs, expenses, and reasonable attorney fees.