

CASTO TECHNICAL SERVICES, INC.

SERVICE REPORT

DATE 4-30-24 ARRIVAL TIME 9:00 DEPARTURE TIME 4:30 JOB/TCK. NO. 206251CUSTOMER P.O. NO. CSS# 97485JOB NAME/LOCATION USARC - Beaver WV002SERVICE REQUESTED (16) Investment is to replace the Actuator that serves the Gas Valve on Burnham Boiler #1 (M# V1115; S#

Manufacture: <u>Burnham</u>				
Model#: <u>V1115</u>				
Serial#: <u>65250056</u>				
Refrigerant Added:	Qty	lb	oz	TYPE
Refrigerant Removed:	Qty	lb	oz	TYPE

☐ Leak Tested

☐ Leak Found

☐ Leak Repaired

Method: _____

Total Charge: _____

WORK PERFORMED/UNIT INFO.

Arrived on site, checked in with customer. Went to the boiler and started taking the bad actuator off. Unwired it and then took set screws loose. Pulled it off and the set the new one in place. Tightened the set screws up and then started wiring it back up. I traced out all the wires and made sure that they all went to where they were supposed to on the actuator. Then once I got it wired up I had to go get a flue analyzer off another coworker and come back. While I was gone I left all the boilers off so that loop would cool off long enough to run the large boiler long enough to do a flue test. I then fired the boiler up but it would not light the pilot. I stuck my hand under the air intake because it sounded like it was getting too much air. It lit but when I pulled my hand away it

NATURE OF WORK

Regular Service _____

Quoted Service _____

Start-up/Warranty _____

SPD _____

Contract Service _____

Energy Management _____

PARTS, MATERIALS AND SUBCONTRACTED SERVICES

QTY.	PART NO.	DESCRIPTION	P.L.	VENDOR	
1		V4062A1131 Actuator		Hvac	240938

SUMMARY OF TIME

SERVICE TECHNICIAN	ON SITE REG.	ON SITE O.T.	REG. TRAVEL	O.T. TRAVEL	TOTAL HRS.	MEALS	LODGING	TOLLS	MILES	OTHER
1154 Shawn Shelton	7.50				7.50					

JOB COMPLETE YES X NO _____ EXPLAIN _____

SIGNATURE



Customer Representative

SERVICE REPORT

DATE _____ ARRIVAL TIME 3:50 pm DEPARTURE TIME _____ JOB/TCK. NO. 206251

CUSTOMER P.O. NO. CSS# 97485

JOB NAME/LOCATION USARC - Beaver WV002
SERVICE REQUESTED 65250056). W/O 15434

Manufacture: <i>Burnham</i>				
Model#: <i>V1115</i>				
Serial#: <i>65250056</i>				
Refrigerant Added:	Qty	lb	oz	TYPE
Refrigerant Removed:	Qty	lb	oz	TYPE

☐ Leak Tested

☐ Leak Found

☐ Leak Repaired

Method: _____

Total Charge: _____

WORK PERFORMED/UNIT INFO.

went out. I called tech support and they gave me the factor settings. I adjusted them to low fire on 23 and high fire to 70 on the damper actuator. Once i fired it up the boiler fired up and started running. I took the flue test and had to make a few adjustments but then the numbers on flue analyzer fell in place. I then let boiler run and made sure it was going to light back up a few times. Then turned all the little boilers back on and told client i was done. Then cleaned up mess and done paper work.

NATURE OF WORK

Regular Service _____
Quoted Service _____
Start-up/Warranty _____
SPD _____
Contract Service _____
Energy Management _____

PARTS, MATERIALS AND SUBCONTRACTED SERVICES

[illegible]

SUMMARY OF TIME

[illegible]

JOB COMPLETE YES _____ NO _____ EXPLAIN _____

SIGNATURE _____

Customer Representative