

SERVICE REPORT

DATE 5-4-23 ARRIVAL TIME 10:00 DEPARTURE TIME 12:00 JOB/TCK. NO. 196480

CUSTOMER P.O. NO. **CSS93381**

JOB NAME/LOCATION *USARC - Rainelle WV034*

SERVICE REQUESTED *NO Heat in both the training building and OMS
NTE \$450.00 Call Reg Cook with Findings. WO12789*

| | | | | |
|-----------------------------|-----|----|----|------|
| Manufacture: <u>Burnham</u> | | | | |
| Model#: <u>APX500F-2L07</u> | | | | |
| Serial#: <u>65260495</u> | | | | |
| Refrigerant Added: | Qty | lb | oz | TYPE |
| Refrigerant Removed: | Qty | lb | oz | TYPE |

☐ Leak Tested

☐ Leak Found

☐ Leak Repaired

Method: _____

Total Charge: _____

WORK PERFORMED/UNIT INFO.

Arrived on site, checked in with customer. Went to boiler room and found that the boiler was in an alarm. Put my display on the burner control and it said it was out on airflow switch inter lock. Tried resetting it but then noticed the power light was out. Found a fuse blown at the top of the main control board. Replaced the fuse and the power light came on. Then started testing the airflow switch and it tested out fine. Looked on wiring print and seen that the power leaving A1 on the board went through the switch and then through aux switch on contactor that was normally open then back to A2 on the board. The alarm said it was still see air flow when there wasn't any and found that what ever blew the fuse burnt something up inside the burner controller.

NATURE OF WORK

Regular Service _____
Quoted Service _____
Start-up/Warranty _____
SPD _____
Contract Service _____
Energy Management _____

PARTS, MATERIALS AND SUBCONTRACTED SERVICES

[illegible]

SUMMARY OF TIME

[illegible]

JOB COMPLETE YES X NO _____ EXPLAIN _____

SIGNATURE _____

Customer Representative

SERVICE REPORT

CUSTOMER P.O. NO. CSS93381

SERVICE REQUESTED

| | | | | |
|-----------------------------|-----|----|----|------|
| Manufacture: <i>Burnham</i> | | | | |
| Model#: <i>APX500F-2L07</i> | | | | |
| Serial#: <i>65260495</i> | | | | |
| Refrigerant Added: | Qty | lb | oz | TYPE |
| Refrigerant Removed: | Qty | lb | oz | TYPE |

☐ Leak Tested

☐ Leak Found

☐ Leak Repaired

Method: _____

Total Charge: _____

Cleaned up tools and called client and told him what i had found and he asked to send a quote for a new burner controller. Then done paper work.

NATURE OF WORK

Regular Service _____

Quoted Service _____

Start-up/Warranty _____

SPD _____

Contract Service _____

Energy Management _____

[illegible][illegible]

JOB COMPLETE YES _____ NO _____ EXPLAIN _____

SIGNATURE _____

Customer Representative