

SERVICE REPORT

DATE 2024 6 6 ARRIVAL TIME 8:30am DEPARTURE TIME 11:00am JOB/TCK. NO. 209398

CUSTOMER P.O. NO. CSS# 98082

JOB NAME/LOCATION USARC - Bluefield WV005

SERVICE REQUESTED *No AC Daikin System is throwing an Error H7 code for supply zone. TRS states that it went out on Monday/*

Manufacture: <i>Daikin</i>				
Model#: <i>REYQ96PBTJ</i>				
Serial#: <i>A000151</i>				
Refrigerant Added:	Qty	lb	oz	TYPE
Refrigerant Removed:	Qty	lb	oz	TYPE

☐ Leak Tested

☐ Leak Found

☐ Leak Repaired

Method: _____

Total Charge: _____

WORK PERFORMED/UNIT INFO.

Arrived on site checked in with customer. Had customer take me to main controller to check alarm that had been reported. CU-1 had an H7 alarm present, which is outdoor unit fan motor signal failure. Checked thermostats and board on outdoor unit and no alarm was present. Hooked service checker up to verify. Referred to flow chart and found that motor was grounded on 1 of the signal legs. Motor still runs, but will not modulate as it should. Packed up tools and let customer know I was finished. Will submit quote to replace fan motor.

NATURE OF WORK

Regular Service _____
Quoted Service _____
Start-up/Warranty _____
SPD _____
Contract Service _____
Energy Management _____

PARTS, MATERIALS AND SUBCONTRACTED SERVICES

[illegible]

SUMMARY OF TIME

[illegible]

JOB COMPLETE YES X NO _____ EXPLAIN _____

SIGNATURE _____

Customer Representative