

## CASTO TECHNICAL SERVICES, INC.

## SERVICE REPORT

DATE 3-17-23 ARRIVAL TIME 8:00 DEPARTURE TIME 12:30 JOB/TCK. NO. 193283CUSTOMER P.O. NO. CSS# 91542JOB NAME/LOCATION USARC - New River Valley Memorial VA012SERVICE REQUESTED (7) Investment is labor and material to cut the elbows out, put in new piping, and repair the leaking piping.

Manufacture: <u>Other</u>				
Model#: <u>SOLO 399</u>				
Serial#: <u>PS69278</u>				
Refrigerant Added:	Qty	lb	oz	TYPE
Refrigerant Removed:	Qty	lb	oz	TYPE

☐ Leak Tested

☐ Leak Found

☐ Leak Repaired

Method: \_\_\_\_\_

Total Charge: \_\_\_\_\_

## WORK PERFORMED/UNIT INFO.

Stopped by Lowes on the way done and picked up glue for the pipe. Arrived on site, checked in with customer. Took tools to the boiler room. Then went and got ladder and set it up. Used band saw and cut the pipe off half way between each elbow. Then cleaned the paint off the pipe with sand paper. then measured the pipe that i had cut out. Then dry fit all the piping and ended up having to cut the bottom pipe off more to get my slant in the pipe for the condensation to drain out of the piping. When i went to glue it all together there was nothing holding the pipe and it turned on me. I turned it to where i thought it was straight then went out side and looked and made sure. Ended up having to turn it just a little more and then i marked the top of the pipe so i

## NATURE OF WORK

Regular Service \_\_\_\_\_

Quoted Service \_\_\_\_\_

Start-up/Warranty \_\_\_\_\_

SPD \_\_\_\_\_

Contract Service \_\_\_\_\_

Energy Management \_\_\_\_\_

## PARTS, MATERIALS AND SUBCONTRACTED SERVICES

QTY.	PART NO.	DESCRIPTION	P.L.	VENDOR	
1		Shipping & Handling		Hajoca	228350
2		PVC DW 90 degree elbow		Hajoca	228350
2		PVC DW coupling		Hajoca	228350
10		4x10 pvc pipe		Hajoca	228350

## SUMMARY OF TIME

SERVICE TECHNICIAN	ON SITE REG.	ON SITE O.T.	REG. TRAVEL	O.T. TRAVEL	TOTAL HRS.	MEALS	LODGING	TOLLS	MILES	OTHER
1154 Shawn Shelton	4.5		2.5		7					

JOB COMPLETE YES X NO \_\_\_\_\_ EXPLAIN \_\_\_\_\_

SIGNATURE \_\_\_\_\_

Customer Representative

## SERVICE REPORT

CUSTOMER P.O. NO. CSS# 91542

Manufacture: <u>Other</u>				
Model#: <u>SOLO 399</u>				
Serial#: <u>PS69278</u>				
Refrigerant Added:	Qty	lb	oz	TYPE
Refrigerant Removed:	Qty	lb	oz	TYPE

☐ Leak Tested

☐ Leak Found

☐ Leak Repaired

Method: \_\_\_\_\_

Total Charge: \_\_\_\_\_

knew where it had to be when i glued it all together. Once I got it all together I cleaned up tools. Then went and found a broom and cleaned up all the piping shavings from where i cut the pipe for the job. Then put broom back and took pictures of the job and done paper work.

Regular Service \_\_\_\_\_  
Quoted Service \_\_\_\_\_  
Start-up/Warranty \_\_\_\_\_  
SPD \_\_\_\_\_  
Contract Service \_\_\_\_\_  
Energy Management \_\_\_\_\_

[illegible][illegible]

SIGNATURE \_\_\_\_\_

Customer Representative