

SERVICE REPORT

DATE 2024 12 3 ARRIVAL TIME 8:30am DEPARTURE TIME 3:30pm JOB/TCK. NO. 215223

CUSTOMER P.O. NO. CSS# 54485

JOB NAME/LOCATION *USARC - Bluefield WV005*

SERVICE REQUESTED *Emergency call - No heat, Daikin System throwing 2 error codes, tried to reset but didnt work. Error code E5 and JA.*

Manufacture: <u>Daikin</u>				
Model#: <u>REYQ144PBTJ</u>				
Serial#: <u>A000243</u>				
Refrigerant Added:	Qty	lb	oz	TYPE
Refrigerant Removed:	Qty	lb	oz	TYPE

☐ Leak Tested

☐ Leak Found

☐ Leak Repaired

Method: _____

Total Charge: _____

WORK PERFORMED/UNIT INFO.

Went to CU-1. After referring back to troubleshooting flow chart, megged compressor to make sure it was in line with manufacturers specifications. I then disconnected compressor wires from peckerhead and placed unit in inverter power transistor check mode to make sure inverter board was functioning correctly and sending correct voltage to compressor. These checks were good which only leaves internal damage in the inverter compressor. Will quote to replace inverter compressor.

NATURE OF WORK

Regular Service _____
Quoted Service _____
Start-up/Warranty _____
SPD _____
Contract Service _____
Energy Management _____

PARTS, MATERIALS AND SUBCONTRACTED SERVICES

[illegible]

SUMMARY OF TIME

[illegible]

JOB COMPLETE YES X NO _____ EXPLAIN _____

SIGNATURE _____

Customer Representative