

## SERVICE REPORT

DATE 2024 12 3 ARRIVAL TIME 8:30am DEPARTURE TIME 3:30pm JOB/TCK. NO. 215491

CUSTOMER P.O. NO. FEMS 2965965

**JOB NAME/LOCATION** *USARC - Bluefield WV005*

**SERVICE REQUESTED** (48) Investment is to Recover Refrigerant, Leak Check, Pull a Vacuum, and Recharge Daikin VRF CU-2 (M# REYQ96;

Manufacture: <i>Daikin</i>				
Model#: <i>REYQ144PBTJ</i>				
Serial#: <i>A000243</i>				
Refrigerant Added:	Qty	lb	oz	TYPE
Refrigerant Removed:	Qty	lb	oz	TYPE

☐ Leak Tested

☐ Leak Found

☐ Leak Repaired

Method: \_\_\_\_\_

Total Charge: \_\_\_\_\_

**WORK PERFORMED/UNIT INFO.**

Arrived on site checked in with customer. Went around building to locate each of the heads before charging system with nitrogen. Left ceiling tiles out to have easier access when ready. Went to CU-2. Placed unit in recovery mode to open valves throughout system. Charged with around 200 psi of nitrogen. While spraying fittings I could hear what sounded like a leak behind the electrical panel but could not get to it. Unwired electrical panel and removed. Found leak on capillary tube that runs from suction line to the oil separator. Pulled a parts layout from online to try and find the exact name or part number for it but could not find anything. Called Daikin tech support so I would not receive the wrong part and after holding explained what I was

### NATURE OF WORK

Regular Service \_\_\_\_\_  
Quoted Service \_\_\_\_\_  
Start-up/Warranty \_\_\_\_\_  
SPD \_\_\_\_\_  
Contract Service \_\_\_\_\_  
Energy Management \_\_\_\_\_

#### PARTS, MATERIALS AND SUBCONTRACTED SERVICES

[illegible]

## SUMMARY OF TIME

[illegible]

JOB COMPLETE YES X NO \_\_\_\_\_ EXPLAIN \_\_\_\_\_

SIGNATURE \_\_\_\_\_

Customer Representative

## SERVICE REPORT

CUSTOMER P.O. NO. FEMS 2965965

**SERVICE REQUESTED** S# A000151). NTE.--provide a separate quote for any additional repairs required to get the system operational.

Manufacture: <i>Daikin</i>				
Model#: <i>REYQ144PBTJ</i>				
Serial#: <i>A000243</i>				
Refrigerant Added:	Qty	lb	oz	TYPE
Refrigerant Removed:	Qty	lb	oz	TYPE

☐ Leak Tested

☐ Leak Found

☐ Leak Repaired

Method: \_\_\_\_\_

Total Charge: \_\_\_\_\_

looking for. They gave me a part number for the capillary tube which I will send in along with the quote. Reinstalled electrical panel and outside panels. Went back inside and placed ceiling tiles back in their spots. Called Reginald and let him know I would be sending in a quote for the repair. Went back to troubleshooting CU-1 after I finished.

**NATURE OF WORK**

Regular Service \_\_\_\_\_

Quoted Service \_\_\_\_\_

Start-up/Warranty \_\_\_\_\_

SPD \_\_\_\_\_

Contract Service \_\_\_\_\_

Energy Management \_\_\_\_\_

[illegible][illegible]

SIGNATURE \_\_\_\_\_

Customer Representative