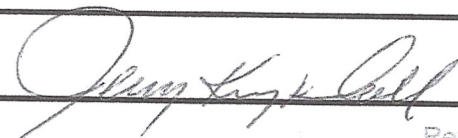


Argent Inspections

Form AI-03


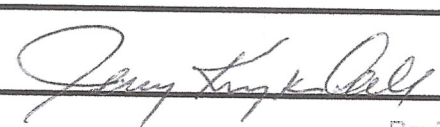
Boiler Inspection Report

Inspection Date 9/20/2021	Certificate Issued Yes	Expiration Date 9/20/2022	Prepared for Inspection Yes	Next Watersides/Firesides 2023/2022	Next Strength Test
Inspection Type(s) Performed					
☒ Internal ☐ Watersides ☒ Firesides ☒ External/Operational ☒ Pressure Test ☐ Strength ☒ Tightness					
Customer 99th RSC R2 Z3 NY127 USARC Nichols			Boiler Location Name and/or Building Number Boiler Room		
Address 881 Stanton Hill rd.			Boiler Location Address		
City Nichols	State NY	Zip 13812	City	State	Zip 0
National Board # 282120	Jurisdiction #	Property # B-1-0	Boiler Use Closed Heating Loop	Fuel Type Natural Gas	
Manufacturer Lochinvar		Model # KBN400	Serial # B-1-0	Year Built 2013	
Capacity 418,000 BTU/HR	Design Pressure 160 psi	Operating Pressure 12-20 psi	Programmer Manufacturer Lochinvar	Burner Manufacturer Lochinvar	
Number of Safety Valves 1	Combustion Efficiency % CO2 ppm CO % Excess O2			Flue Gas Temperature Degrees F	
	Valve Manufacturer	Size	Set Pressure	Capacity	Lift Pressure
Valve 1	Watts	3/4"	50 psi	950,000 BTU/HR	Hand
Valve 2					Sat
Valve 3:					
Valve 4:					
Safety Devices Tested					
Flame Rod, Low Water Level (electrically), Low flow switch, Combustion air switch, Flue exhaust limit (electrically), Blocked drain switch, Operating limit, High temperature limit with manual reset, Honeywell high temperature limit with manual reset located on outlet line of boiler, Remote E-Stop. The safety valve was lifted by hand per NBIC Part 2 Sec 2.5.7.e. It Lifted freely and resealed with no leakage.					
Reason(s) for Declining Certification					
Comments					
This boiler was inspected using the Unified Facilities Criteria 3-430-07, ASME CSD-1 and the National Board Inspection Code as guides. Light debris observed on firesides. Recommend cleaning the combustion chamber at the mfg. recommended intervals. The boiler was externally inspected at normal operating pressure with no sign of leakage. All controls listed above operated properly during inspection process. Carbon monoxide monitor/alarm is present. The boiler is fired by direct ignition, as such it required gas train supervision. Install low and high gas pressure switches as required by ASME CSD-1 Table CF-3. The remote E-Stop installed is too close to the boiler. It should be installed near the boiler room entrance and labeled for easy identification as required by NBIC Part 1 Section 3.5.3.1. Another E-stop should be installed at other door.					
Inspector Commission 13373	Inspector Dale Brooks	Signature 			
Attachments Yes 2 Pages	Technical Manager Jerry Kuykendall	Signature 			

Argent Inspections

Form AI-03


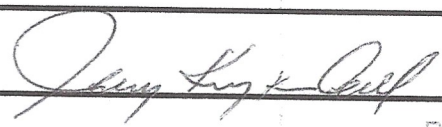
Boiler Inspection Report

Inspection Date 9/20/2021	Certificate Issued Yes	Expiration Date 9/20/2022	Prepared for Inspection Yes	Next Watersides/Firesides 2023/2022	Next Strength Test
Inspection Type(s) Performed ☒ Internal ☐ Watersides ☒ Firesides ☒ External/Operational ☒ Pressure Test ☐ Strength ☒ Tightness					
Customer 99th RSC R2 Z3 NY127 USARC Nichols			Boiler Location Name and/or Building Number Boiler Room		
Address 881 Stanton Hill rd.			Boiler Location Address		
City Nichols	State NY	Zip 13812	City	State	Zip 0
National Board # 276849	Jurisdiction #	Property # B-3-T	Boiler Use Closed Heating Loop	Fuel Type Natural Gas	
Manufacturer Lochinvar		Model # KBN400	Serial # B-3-T	Year Built 2013	
Capacity 418,000 BTU/HR	Design Pressure 160 psi	Operating Pressure 12-20 psi	Programmer Manufacturer Lochinvar	Burner Manufacturer Lochinvar	
Number of Safety Valves 1	Combustion Efficiency % CO2 ppm CO % Excess O2			Flue Gas Temperature Degrees F	
	Valve Manufacturer	Size	Set Pressure	Capacity	Lift Pressure
Valve 1	Watts	3/4"	50 psi	950,000 BTU/HR	Hand
Valve 2					Sat
Valve 3:					
Valve 4:					
Safety Devices Tested					
Reason(s) for Declining Certification					
Comments This boiler was inspected using the Unified Facilities Criteria 3-430-07, ASME CSD-1 and the National Board Inspection Code as guides. Light debris observed on firesides. Recommend cleaning the combustion chamber at the mfg. recommended intervals. The boiler was externally inspected at normal operating pressure with no sign of leakage. Honeywell high temperature limit located at boiler outlet did not function properly, switch was jumped out, reconnected to test. All other controls listed above operated properly during the inspection process. Carbon monoxide monitor/alarm present. Install manual gas valve upstream of boiler as required by ASME CSD-1 CF-150. The boiler is fired by direct ignition, as such it requires gas train supervision. Install low and high gas pressure switches as required by ASME CSD-1 Table CF-3. One remote E-Stop installed as required by NBIC Part 1 Section 3.5.3.1, but not labeled for easy identification. Another E-Stop should be installed at the other door.					
Inspector Commission 13373	Inspector Dale Brooks	Signature 			
Attachments Yes 3 Pages	Technical Manager Jerry Kuykendall	Signature 			

Argent Inspections

Form AI-03


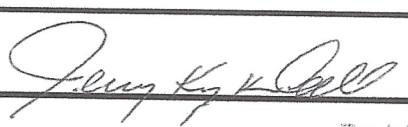
Boiler Inspection Report

Inspection Date 9/20/2021	Certificate Issued Yes	Expiration Date 9/20/2022	Prepared for Inspection Yes	Next Watersides/Firesides 2023/2022	Next Strength Test
Inspection Type(s) Performed ☒ Internal ☐ Watersides ☒ Firesides ☒ External/Operational ☒ Pressure Test ☐ Strength ☒ Tightness					
Customer 99th RSC R2 Z3 NY127 USARC Nichols			Boiler Location Name and/or Building Number Boiler Room		
Address 881 Stanton Hill rd.			Boiler Location Address		
City Nichols	State NY	Zip 13812	City	State	Zip 0
National Board # 276867	Jurisdiction #	Property # B-2-T	Boiler Use Closed Heating Loop	Fuel Type Natural Gas	
Manufacturer Lochinvar		Model # KBN400	Serial # B-2-T	Year Built 2013	
Capacity 418,000 BTU/HR	Design Pressure 160 psi	Operating Pressure 12-20 psi	Programmer Manufacturer Lochinvar	Burner Manufacturer Lochinvar	
Number of Safety Valves 1	Combustion Efficiency % CO2 ppm CO % Excess O2			Flue Gas Temperature Degrees F	
	Valve Manufacturer	Size	Set Pressure	Capacity	Lift Pressure
Valve 1	Watts	3/4"	50 psi	950,000 BTU/HR	Hand
Valve 2					Sat
Valve 3:					
Valve 4:					
Safety Devices Tested Flame Rod, Low Water Level (electrically), Low flow switch, Combustion air switch, Flue exhaust limit (electrically), Blocked drain switch (electrically), Operating temperature control, High temperature limit with manual reset. Honeywell high temperature limit with manual reset located on outlet line of boiler, Remote emergency stop. The safety valve was lifted by hand per NBIC Part 2 Sec 2.5.7.e. It Lifted freely and resealed with no leakage.					
Reason(s) for Declining Certification					
Comments This boiler was inspected using the Unified Facilities Criteria 3-430-07, ASME CSD-1 and the National Board Inspection Code as guides. Light debris observed on firesides. Recommend cleaning the combustion chamber at the mfg. recommended intervals. The boiler was externally inspected at normal operating pressure with no sign of leakage. Honeywell high temperature limit located at boiler outlet did not function properly, switch was jumped out. The switch was reconnected to test. All other controls listed above operated properly during the inspection process. Carbon monoxide monitor/alarm present. Install manual gas valve upstream of boiler as required by ASME CSD-1 CF-150. The boiler is fired by direct ignition, as such it requires gas train supervision. Install low and high gas pressure switches as required by ASME CSD-1 Table CF-3. One remote E-Stop installed as required by NBIC Part 1 Section 3.5.3.1, but not labeled for easy identification. Another E-Stop should be installed at the other door.					
Inspector Commission 13373	Inspector Dale Brooks	Signature 			
Attachments Yes 3 Pages	Technical Manager Jerry Kuykendall	Signature 			

Argent Inspections

Form AI-03

Boiler Inspection Report

Inspection Date 9/20/2021	Certificate Issued Yes	Expiration Date 9/20/2022	Prepared for Inspection Yes	Next Watersides/Firesides 2023/2022	Next Strength Test
Inspection Type(s) Performed ☒ Internal ☐ Watersides ☒ Firesides ☒ External/Operational ☒ Pressure Test ☐ Strength ☒ Tightness					
Customer 99th RSC R2 Z3 NY127 USARC Nichols			Boiler Location Name and/or Building Number Boiler Room		
Address 881 Stanton Hill rd.			Boiler Location Address		
City Nichols	State NY	Zip 13812	City	State	Zip 0
National Board # 276853	Jurisdiction #	Property # B-1-T	Boiler Use Closed Heating Loop	Fuel Type Natural Gas	
Manufacturer Lochinvar		Model # KBN400	Serial # B-1-T	Year Built 2013	
Capacity 418,000 BTU/HR	Design Pressure 160 psi	Operating Pressure 12-20 psi	Programmer Manufacturer Lochinvar	Burner Manufacturer Lochinvar	
Number of Safety Valves 1	Combustion Efficiency % CO2 ppm CO % Excess O2			Flue Gas Temperature Degrees F	
	Valve Manufacturer	Size	Set Pressure	Capacity	Lift Pressure
Valve 1	Watts	3/4"	50 psi	950,000 BTU/HR	Hand
Valve 2					Sat
Valve 3:					
Valve 4:					
Safety Devices Tested Flame Rod, Low Water Level (electrically), Low flow switch, Combustion air switch, Flue exhaust limit (electrically), Blocked drain switch (electrically), Operating temperature control, High temperature limit with manual reset. Honeywell high temperature limit with manual reset located on outlet line of boiler, Remote emergency stop. The safety valve was lifted by hand per NBIC Part 2 Sec 2.5.7.e. It Lifted freely and resealed with no leakage.					
Reason(s) for Declining Certification					
Comments This boiler was inspected using the Unified Facilities Criteria 3-430-07, ASME CSD-1 and the National Board Inspection Code as guides. Light debris observed on firesides. Recommend cleaning the combustion chamber at the mfg. recommended intervals. The boiler was externally inspected at normal operating pressure with no sign of leakage. All controls listed above operated properly during inspection process. Carbon monoxide monitor/alarm present. Install manual gas valve upstream of boiler as required by ASME CSD-1 CF-150. The boiler is fired by direct ignition, as such it requires gas train supervision. Install low and high gas pressure switches as required by ASME CSD-1 Table CF-3. One remote E-Stop installed as required by NBIC Part 1 Section 3.5.3.1, but not labeled for easy identification. Another E-Stop should be installed at the other door.					
Inspector Commission 13373	Inspector Dale Brooks	Signature 			
Attachments Yes 3 Pages	Technical Manager Jerry Kuykendall	Signature 			

Argent Inspections					
Form AI-08			Boiler Inspection Certificate		
Expiration Date 9/20/2022	Inspection Date 9/20/2021	Next Watersides/Firesides 2023/2022	Next Strength Test	National Board # 282120	
Customer 99th RSC R2 Z3 NY127 USARC Nichols			Manufacturer Lochinvar		Year Built 2013
Building # Boiler Room		Serial # B-1-0	Property # B-1-0	Jurisdiction #	
Pressure Allowed 160 psi	Capacity 418,000 BTU/HR	Safety Valves 1	Programmer Mfr Lochinvar	Burner Mfr Lochinvar	
Inspection Type(s) Performed ☒ Internal ☐ Watersides ☒ Firesides ☒ External/Operational ☒ Pressure Test ☐ Strength ☒ Tightness			Fuel Type(s) Certified to Use ☐ Coal ☒ Natural Gas ☐ Light Fuel Oil ☐ Wood ☐ Heavy Fuel Oil		
Commission # 13373	Inspector: Dale Brooks	Signature 			

POST THIS CERTIFICATE UNDER GLASS ON OR NEAR CERTIFIED BOILER

Argent Inspections					
Form AI-08			Boiler Inspection Certificate		
Expiration Date 9/20/2022	Inspection Date 9/20/2021	Next Watersides/Firesides 2023/2022	Next Strength Test	National Board # 276849	
Customer 99th RSC R2 Z3 NY127 USARC Nichols			Manufacturer Lochinvar		Year Built 2013
Building # Boiler Room		Serial # B-3-T	Property # B-3-T	Jurisdiction #	
Pressure Allowed 160 psi	Capacity 418,000 BTU/HR	Safety Valves 1	Programmer Mfr Lochinvar	Burner Mfr Lochinvar	
Inspection Type(s) Performed ☒ Internal ☐ Watersides ☒ Firesides ☒ External/Operational ☒ Pressure Test ☐ Strength ☒ Tightness			Fuel Type(s) Certified to Use ☐ Coal ☒ Natural Gas ☐ Light Fuel Oil ☐ Wood ☐ Heavy Fuel Oil		
Commission # 13373	Inspector: Dale Brooks	Signature 			

POST THIS CERTIFICATE UNDER GLASS ON OR NEAR CERTIFIED BOILER

Argent Inspections					
Form AI-08			Boiler Inspection Certificate		
Expiration Date 9/20/2022	Inspection Date 9/20/2021	Next Watersides/Firesides 2023/2022	Next Strength Test	National Board # 276867	
Customer 99th RSC R2 Z3 NY127 USARC Nichols			Manufacturer Lochinvar		Year Built 2013
Building # Boiler Room		Serial # B-2-T	Property # B-2-T	Jurisdiction #	
Pressure Allowed 160 psi	Capacity 418,000 BTU/HR	Safety Valves 1	Programmer Mfr Lochinvar	Burner Mfr Lochinvar	
Inspection Type(s) Performed ☒ Internal ☐ Watersides ☒ Firesides ☒ External/Operational ☒ Pressure Test ☐ Strength ☒ Tightness			Fuel Type(s) Certified to Use ☐ Coal ☒ Natural Gas ☐ Light Fuel Oil ☐ Wood ☐ Heavy Fuel Oil		
Commission # 13373	Inspector: Dale Brooks	Signature 			

POST THIS CERTIFICATE UNDER GLASS ON OR NEAR CERTIFIED BOILER

Argent Inspections					
Form AI-08			Boiler Inspection Certificate		
Expiration Date 9/20/2022	Inspection Date 9/20/2021	Next Watersides/Firesides 2023/2022	Next Strength Test	National Board # 276853	
Customer 99th RSC R2 Z3 NY127 USARC Nichols			Manufacturer Lochinvar		Year Built 2013
Building # Boiler Room		Serial # B-1-T	Property # B-1-T	Jurisdiction #	
Pressure Allowed 160 psi	Capacity 418,000 BTU/HR	Safety Valves 1	Programmer Mfr Lochinvar	Burner Mfr Lochinvar	
Inspection Type(s) Performed ☒ Internal ☐ Watersides ☒ Firesides ☒ External/Operational ☒ Pressure Test ☐ Strength ☒ Tightness			Fuel Type(s) Certified to Use ☐ Coal ☒ Natural Gas ☐ Light Fuel Oil ☐ Wood ☐ Heavy Fuel Oil		
Commission # 13373	Inspector: Dale Brooks	Signature 			

POST THIS CERTIFICATE UNDER GLASS ON OR NEAR CERTIFIED BOILER