



## Service Items

Name	Description	Tier 1 Price	Unit Type	QTY	Taxable
Labor	See attached pages for details of work performed.	\$0.00	Hour	1	N
<b>TOTAL*:</b>	<b>\$0.00</b>				

\* Not including taxes



## Service Forms

### Daily Form

Fill out every day, even on PMs, and projects

TECH NAME Greg Stephenson

DATE 6/13/2025

POINT OF CONTACT:

DESCRIPTION OF WORK PERFORMED Replaced ignition board in co-ray vac unit. This unit is still not operating correctly. Burner lights then goes back out. Started looking at the entire system. Need a u-tube manometer to set vacuum up and go over system. Will need to return.

TOOLS USED hand tools

MATERIALS USED OR PICTURE OF TAG\* 1- 90439501K ignition board

HOURS REGULAR:

OVERTIME:



## Attachments



## Service Items

Name	Description	Tier 1 Price	Unit Type	QTY	Taxable
Labor	See attached pages for details of work performed.	\$0.00	Hour	1	N
<b>TOTAL*:</b>	<b>\$0.00</b>				

\* Not including taxes



## Service Forms

### Daily Form

Fill out every day, even on PMs, and projects

TECH NAME Jacob Powell

DATE 06-13-2025

POINT OF CONTACT: Cindy

DESCRIPTION OF WORK PERFORMED  
installed the new ignition module on the co ray vac system at usarc ecs. tried to test the system out in heat but it was only firing for 15 seconds then tripping out. we noticed that this was not the only co ray vac that was not running as well and we believe that it is due to the vacuum pressure being too great. we will need to return to go through the entire system and check to make sure that it is set up properly with the manufacturers specs. for now the co ray vac system is off due to the radiant heat not needing to be on right now.

TOOLS USED hand tools, meter, manometer

MATERIALS USED OR PICTURE OF TAG\* 1- ignition module bought for job

HOURS REGULAR:

OVERTIME:




## Attachments

**Title**

1000004370 06/13/2025  
02:35 PM


**File Name**

5ae39987-2cc8-41d3-8d41-244b6d5dbb3e.jpg

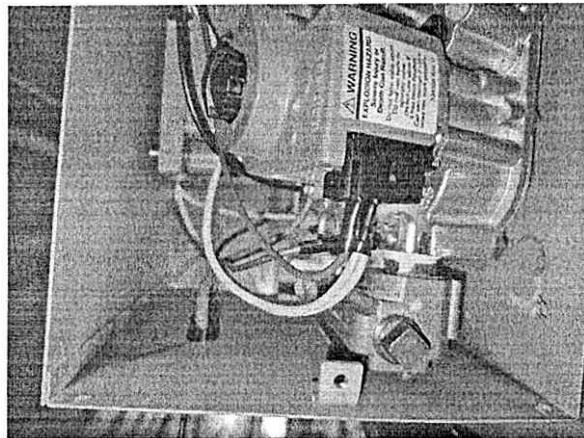

1000004369 06/13/2025  
02:35 PM

03387b2c-a828-4f95-b6b8-ffabbd3eb488.jpg

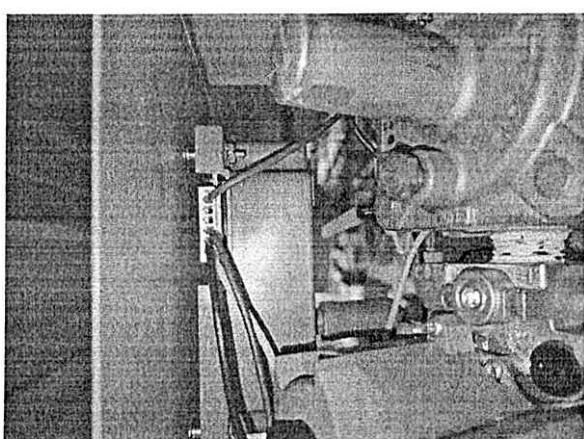

1000004371 06/13/2025  
02:35 PM

a61e05d4-06ea-4e25-a516-d049f6a31782.jpg



**CERTIFICATION OF WORK**  
(To be completed by the Contractor and saved in the Contractor's CMMS)

FACID/Building: PA118 Date of Visit: 6/13/25

Contractor Personnel on Site:

1. Greg Stephenson      2. Jacob Powell

**Work Performed:**

**Preventive Maintenance - Services Completed (Annual, Quarterly, Monthly, equipment identification, etc.)**

1. CoRay Ignition Control Module Replacement

**Service Calls – Service Call Number and Description**

1. CSS# PO-0001772  
2. CSS# \_\_\_\_\_  
3. CSS# \_\_\_\_\_

---

**CERTIFICATION OF WORK**

To be signed by the Contractor:

Print Name: Jacob Powell Date: 6/20/25

Signed: Jacob Powell

To be signed by Facility Manager:

By signing the Certification of Work, I certify that the above-named individuals representing the Contractor arrived on site and to the best of my knowledge, completed the stated work listed.  
This is NOT a Certification that the Work was performed correctly – The COW simply verifies that that someone representing the Contractor was onsite and accomplished something

Print Name/Rank: \_\_\_\_\_ Date: \_\_\_\_\_

Signed: Robert

E-Mail: scott.w.kawski.civ@army.mil