

## CERTIFICATION OF WORK SERVICE CALL

(To be completed by the Contractor and saved in the Contractor's CMMS)

FACID/Building: VA049 Date of Visit: 3-20-2020

Contractor Personnel on Site:

1. Jacob Elton
2. \_\_\_\_\_
3. \_\_\_\_\_
4. \_\_\_\_\_
5. \_\_\_\_\_
6. \_\_\_\_\_

Service Call Number

CSS# 24215 WO# 11952 /12037

Description of Repairs

Replaced FCU 5 and FCU 6 tstats  
reprogrammed. Need to return to finish troubleshooting  
AHU-5 and FCU-7

## CERTIFICATION OF WORK

To be signed by the Contractor:

Print Name: Jacob Elton Date: 3-20-2020

Signed: J. Elton

To be signed by Facility Manager:

By signing the Certification of Work, the said government representative signature does not constitute acceptance of any work performed by the contractor, it only acknowledges that the contractor was on-site during the identified timeline:

Print Name/Rank: Carlos M. Nieves / GS-09 Date: Mar 20, 2020

Signed: Carlos M. Nieves

E-Mail: \_\_\_\_\_

## CERTIFICATION OF WORK SERVICE CALL

(To be completed by the Contractor and saved in the Contractor's CMMS)

FACID/Building: VA049 Date of Visit: 3-27-2019

Contractor Personnel on Site:

1. <u>Mark Anderson</u>	4. _____
2. _____	5. _____
3. _____	6. _____

**Service Call Number**

CSS# 24215 WO# 11952 /12037

### **Description of Repairs**

Finish repairs on FCU 5,6,7 and AHU-5, After troubleshooting I determined that the original work that was supposed to be completed was not. Hot water valves were never installed for the FCUs and duct work was never ran. FCUs are hanging in ceiling and not ducted to areas that they are supposed to be serving. There is still plastic taped over the supply and returns of FCUs. HWV actuators are laying above ceiling wired but no valve in HW piping to mount to. FCU-7, 120v power is hanging out of junction box and not wired to FCU. AHU 5 is the same way, There is no belt on the supply fan. Supply fan starter as not been wired.

---

## CERTIFICATION OF WORK

To be signed by the Contractor:

Print Name: Jacob Elton Date: 3-27-2020

Signed: 

To be signed by Facility Manager:

By signing the Certification of Work, the said government representative signature does not constitute acceptance of any work performed by the contractor, it only acknowledges that the contractor was on-site during the identified timeline:


Print Name/Rank: Mark Anderson Date: 3-27-2020


Signed: 


E-Mail: Mark.s.anderson7.mil@mail.mil

3/27/2020


AHU 5 HWV.JPG

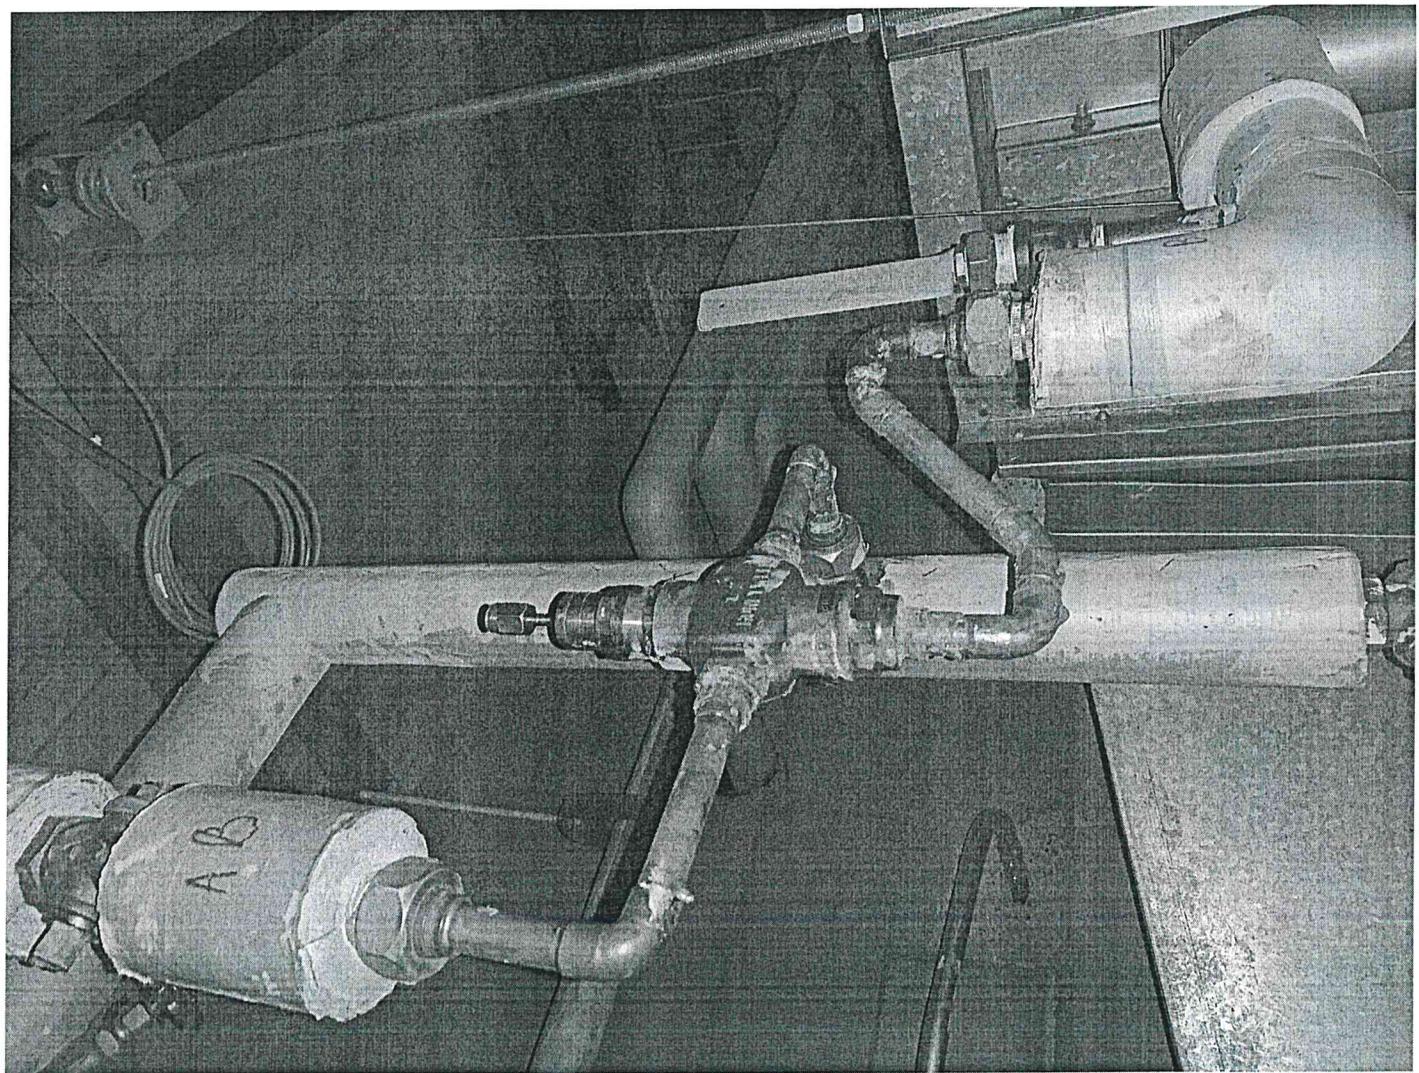


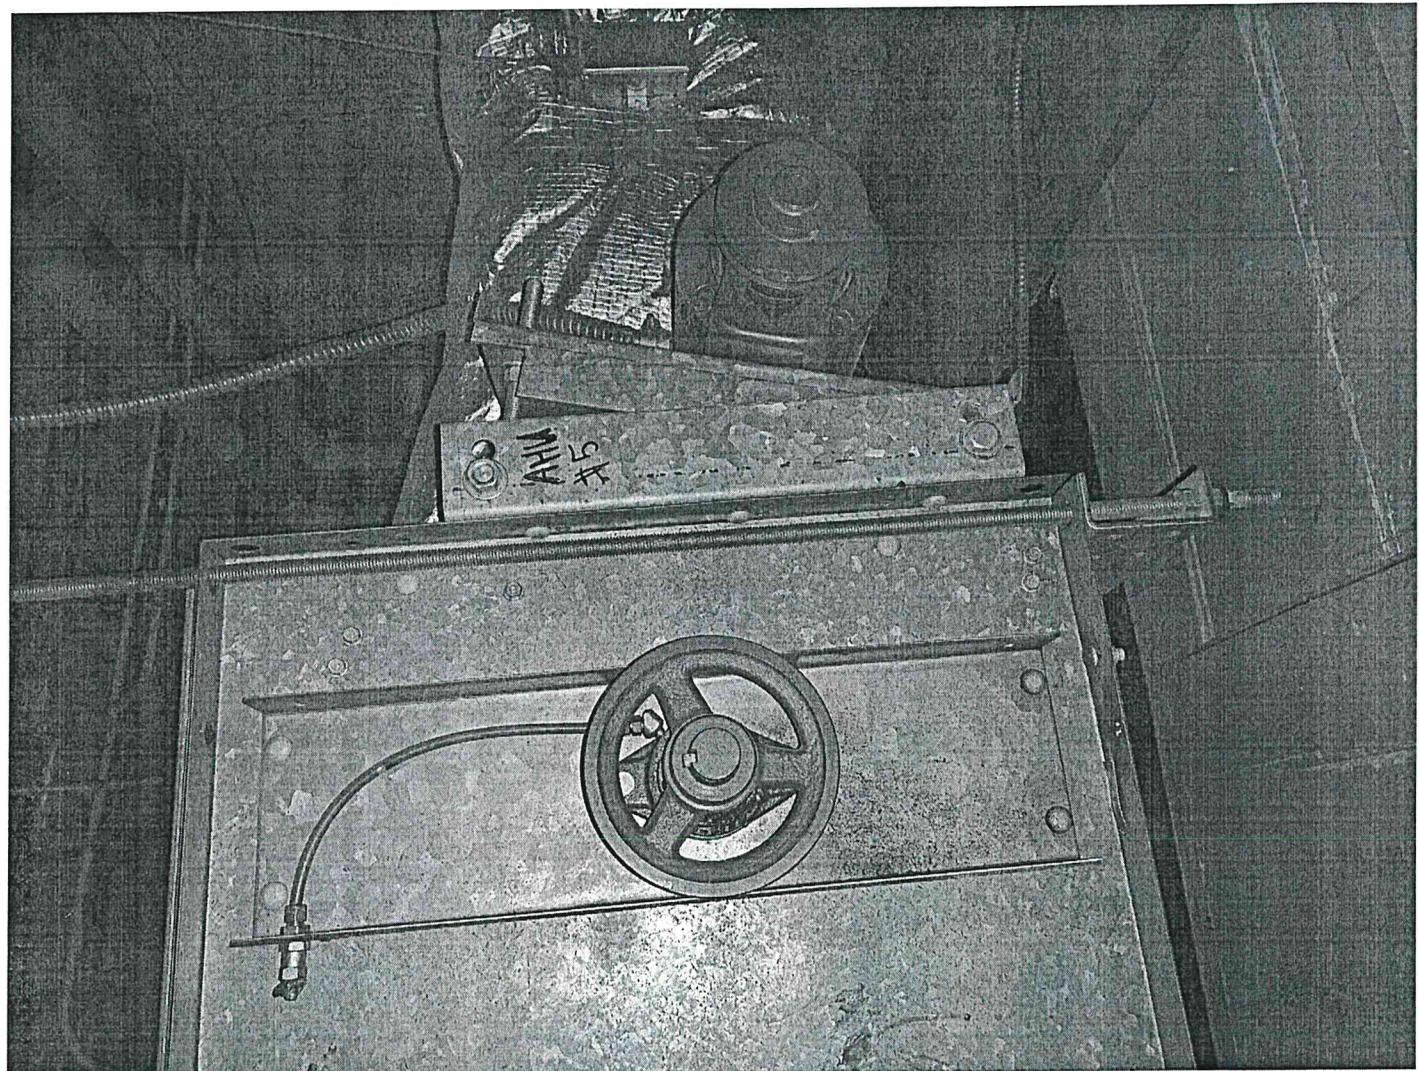

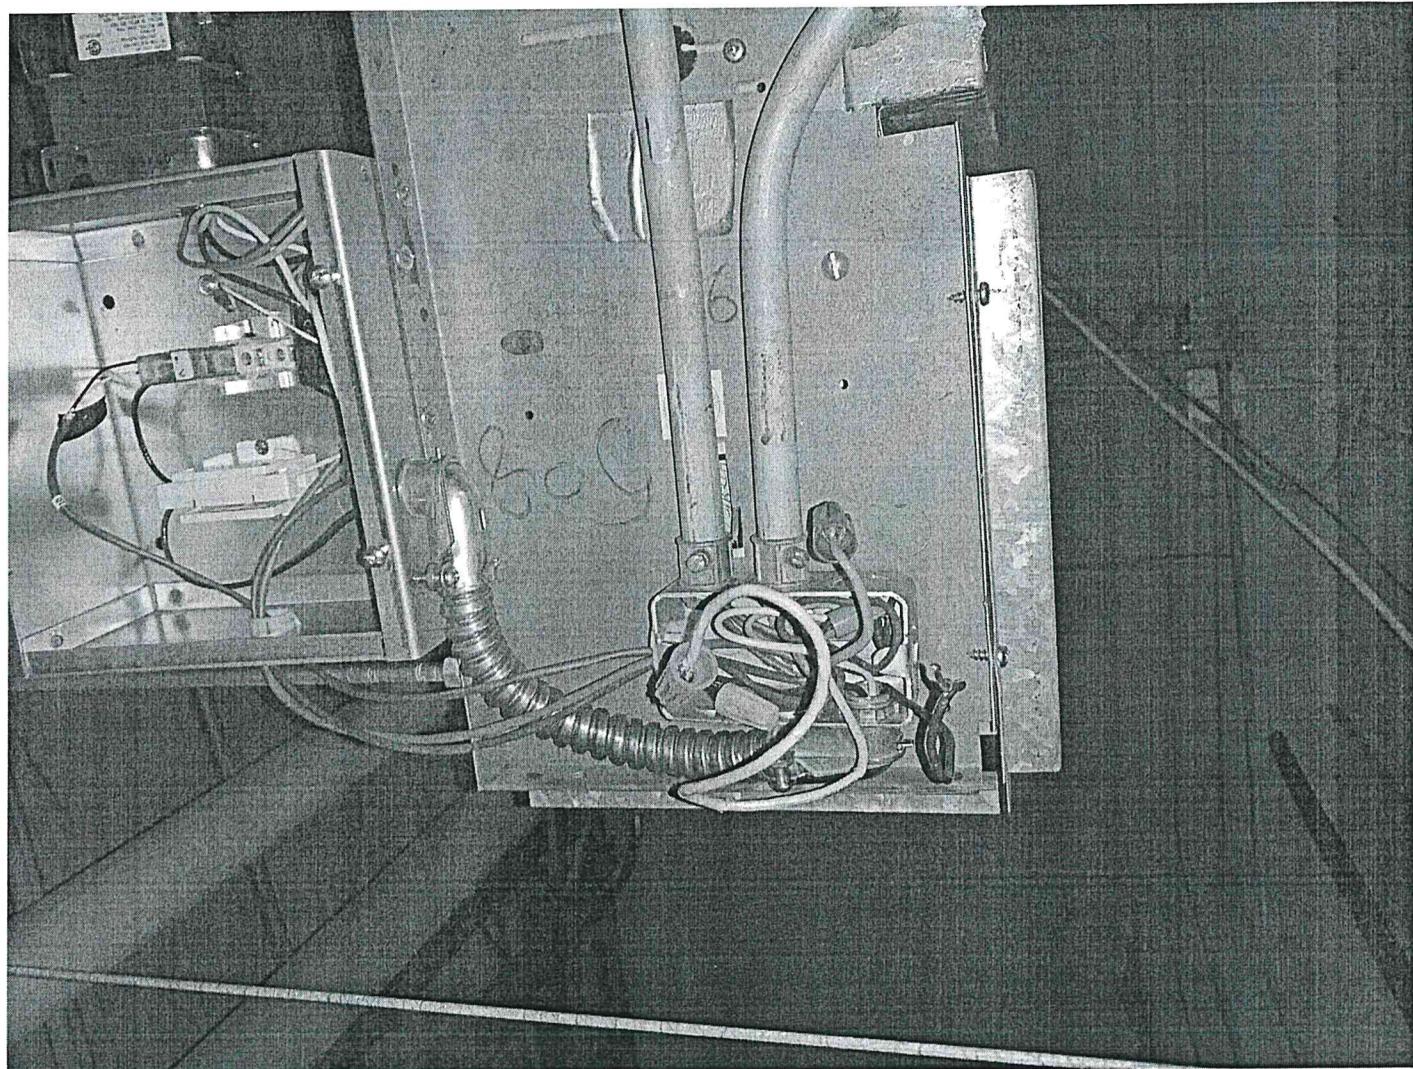



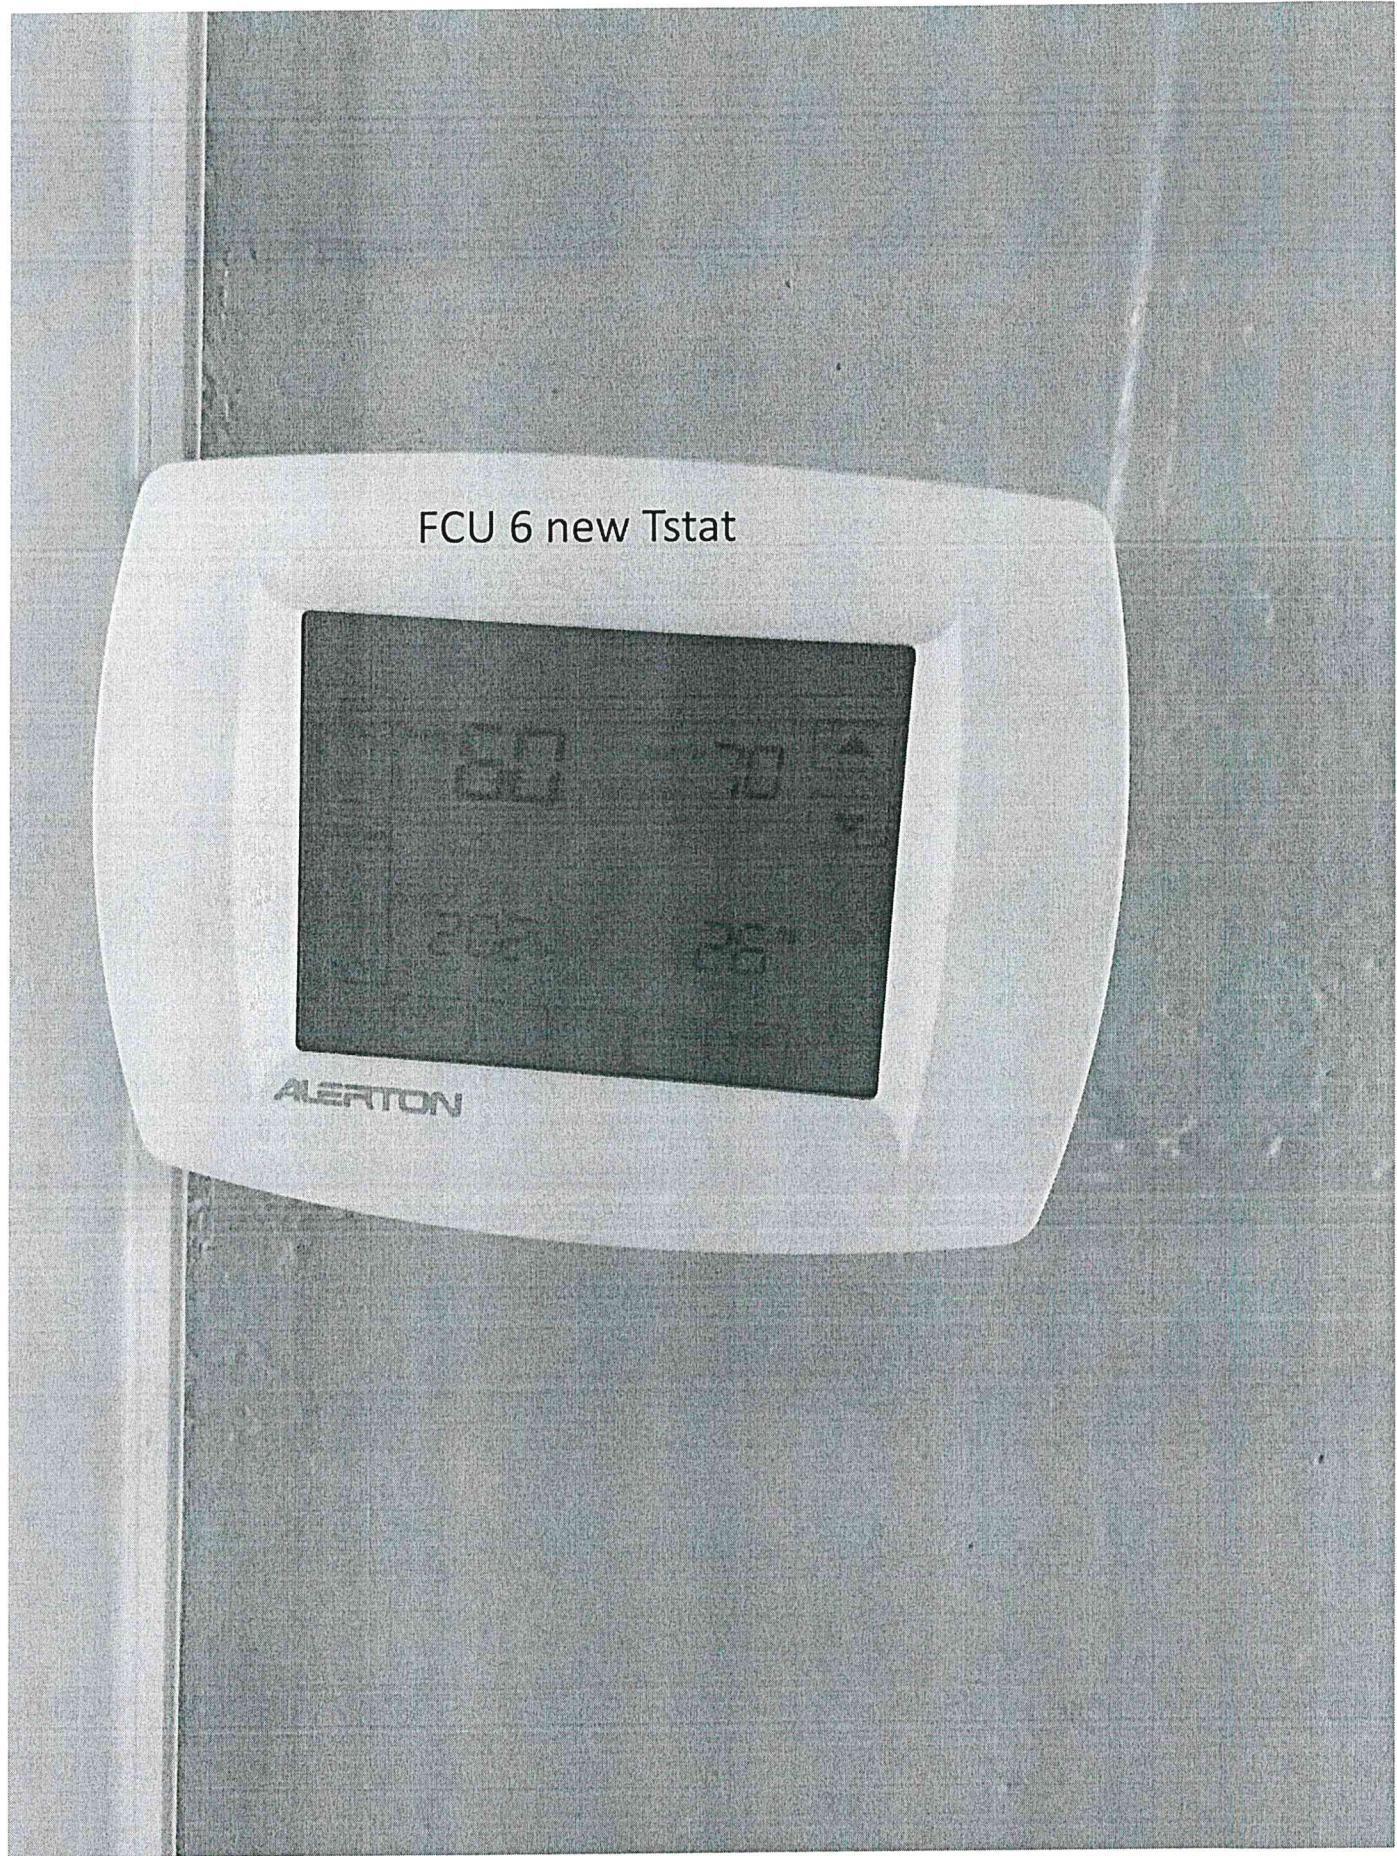

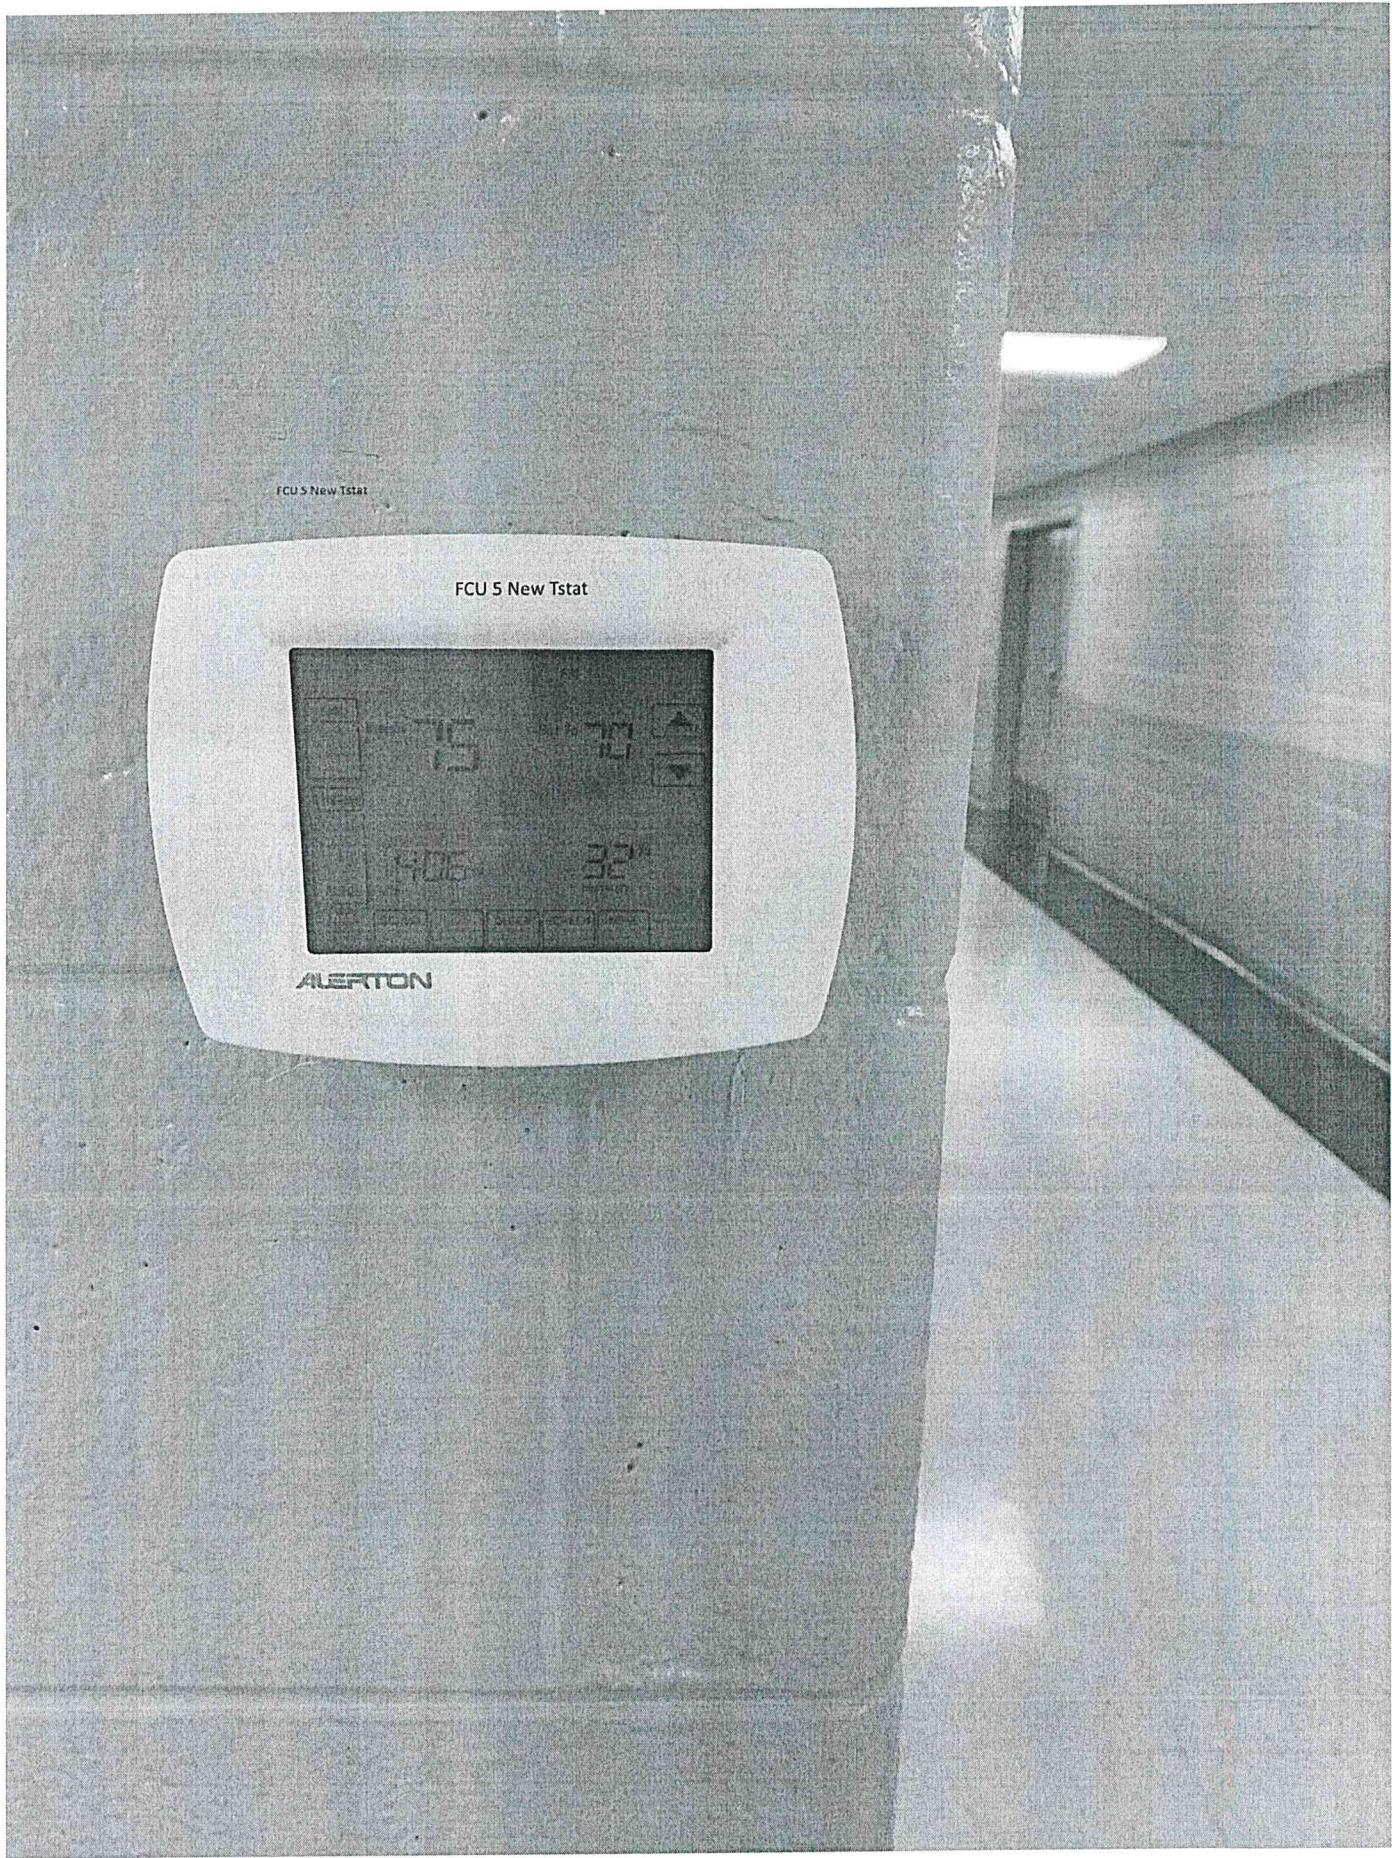

3/27/2020

FCU 5 HWV.jpg

