

**CERTIFICATION OF WORK
SERVICE CALL**

(To be completed by the Contractor and saved in the Contractor's CMMS)

Richmond AFRC

FACID/Building: VA050 Date of Visit: October 10, 2020

Contractor Personnel on Site:

- | | |
|----------------------------|----------|
| 1. <u>Nicholas LoRusso</u> | 4. _____ |
| 2. _____ | 5. _____ |
| 3. _____ | 6. _____ |

Service Call Number

CSS# 24781 WO# 12857

Description of Repairs

LoCurrent arrived on-site, inspected gate. Found broken pivot pin for drive roller arm. → removed, repaired and reinstalled. Found loose Loop Detector wires causing gate to open falsely. → tightened down Loop Detector wires and reinitialized Loop Detector Module, tested Gate. 100% operational at the time of departure.

CERTIFICATION OF WORK

To be signed by the Contractor:

Print Name: Nicholas LoRusso Date: October 10, 2020

Signed: Nicholas LoRusso


To be signed by Facility Manager:

By signing the Certification of Work, the said government representative signature does not constitute acceptance of any work performed by the contractor, it only acknowledges that the contractor was on-site during the identified timeline:

Print Name/Rank: Completed on a weekend Date: _____

Signed: no personnel on site at the

E-Mail: time of completion to sign.

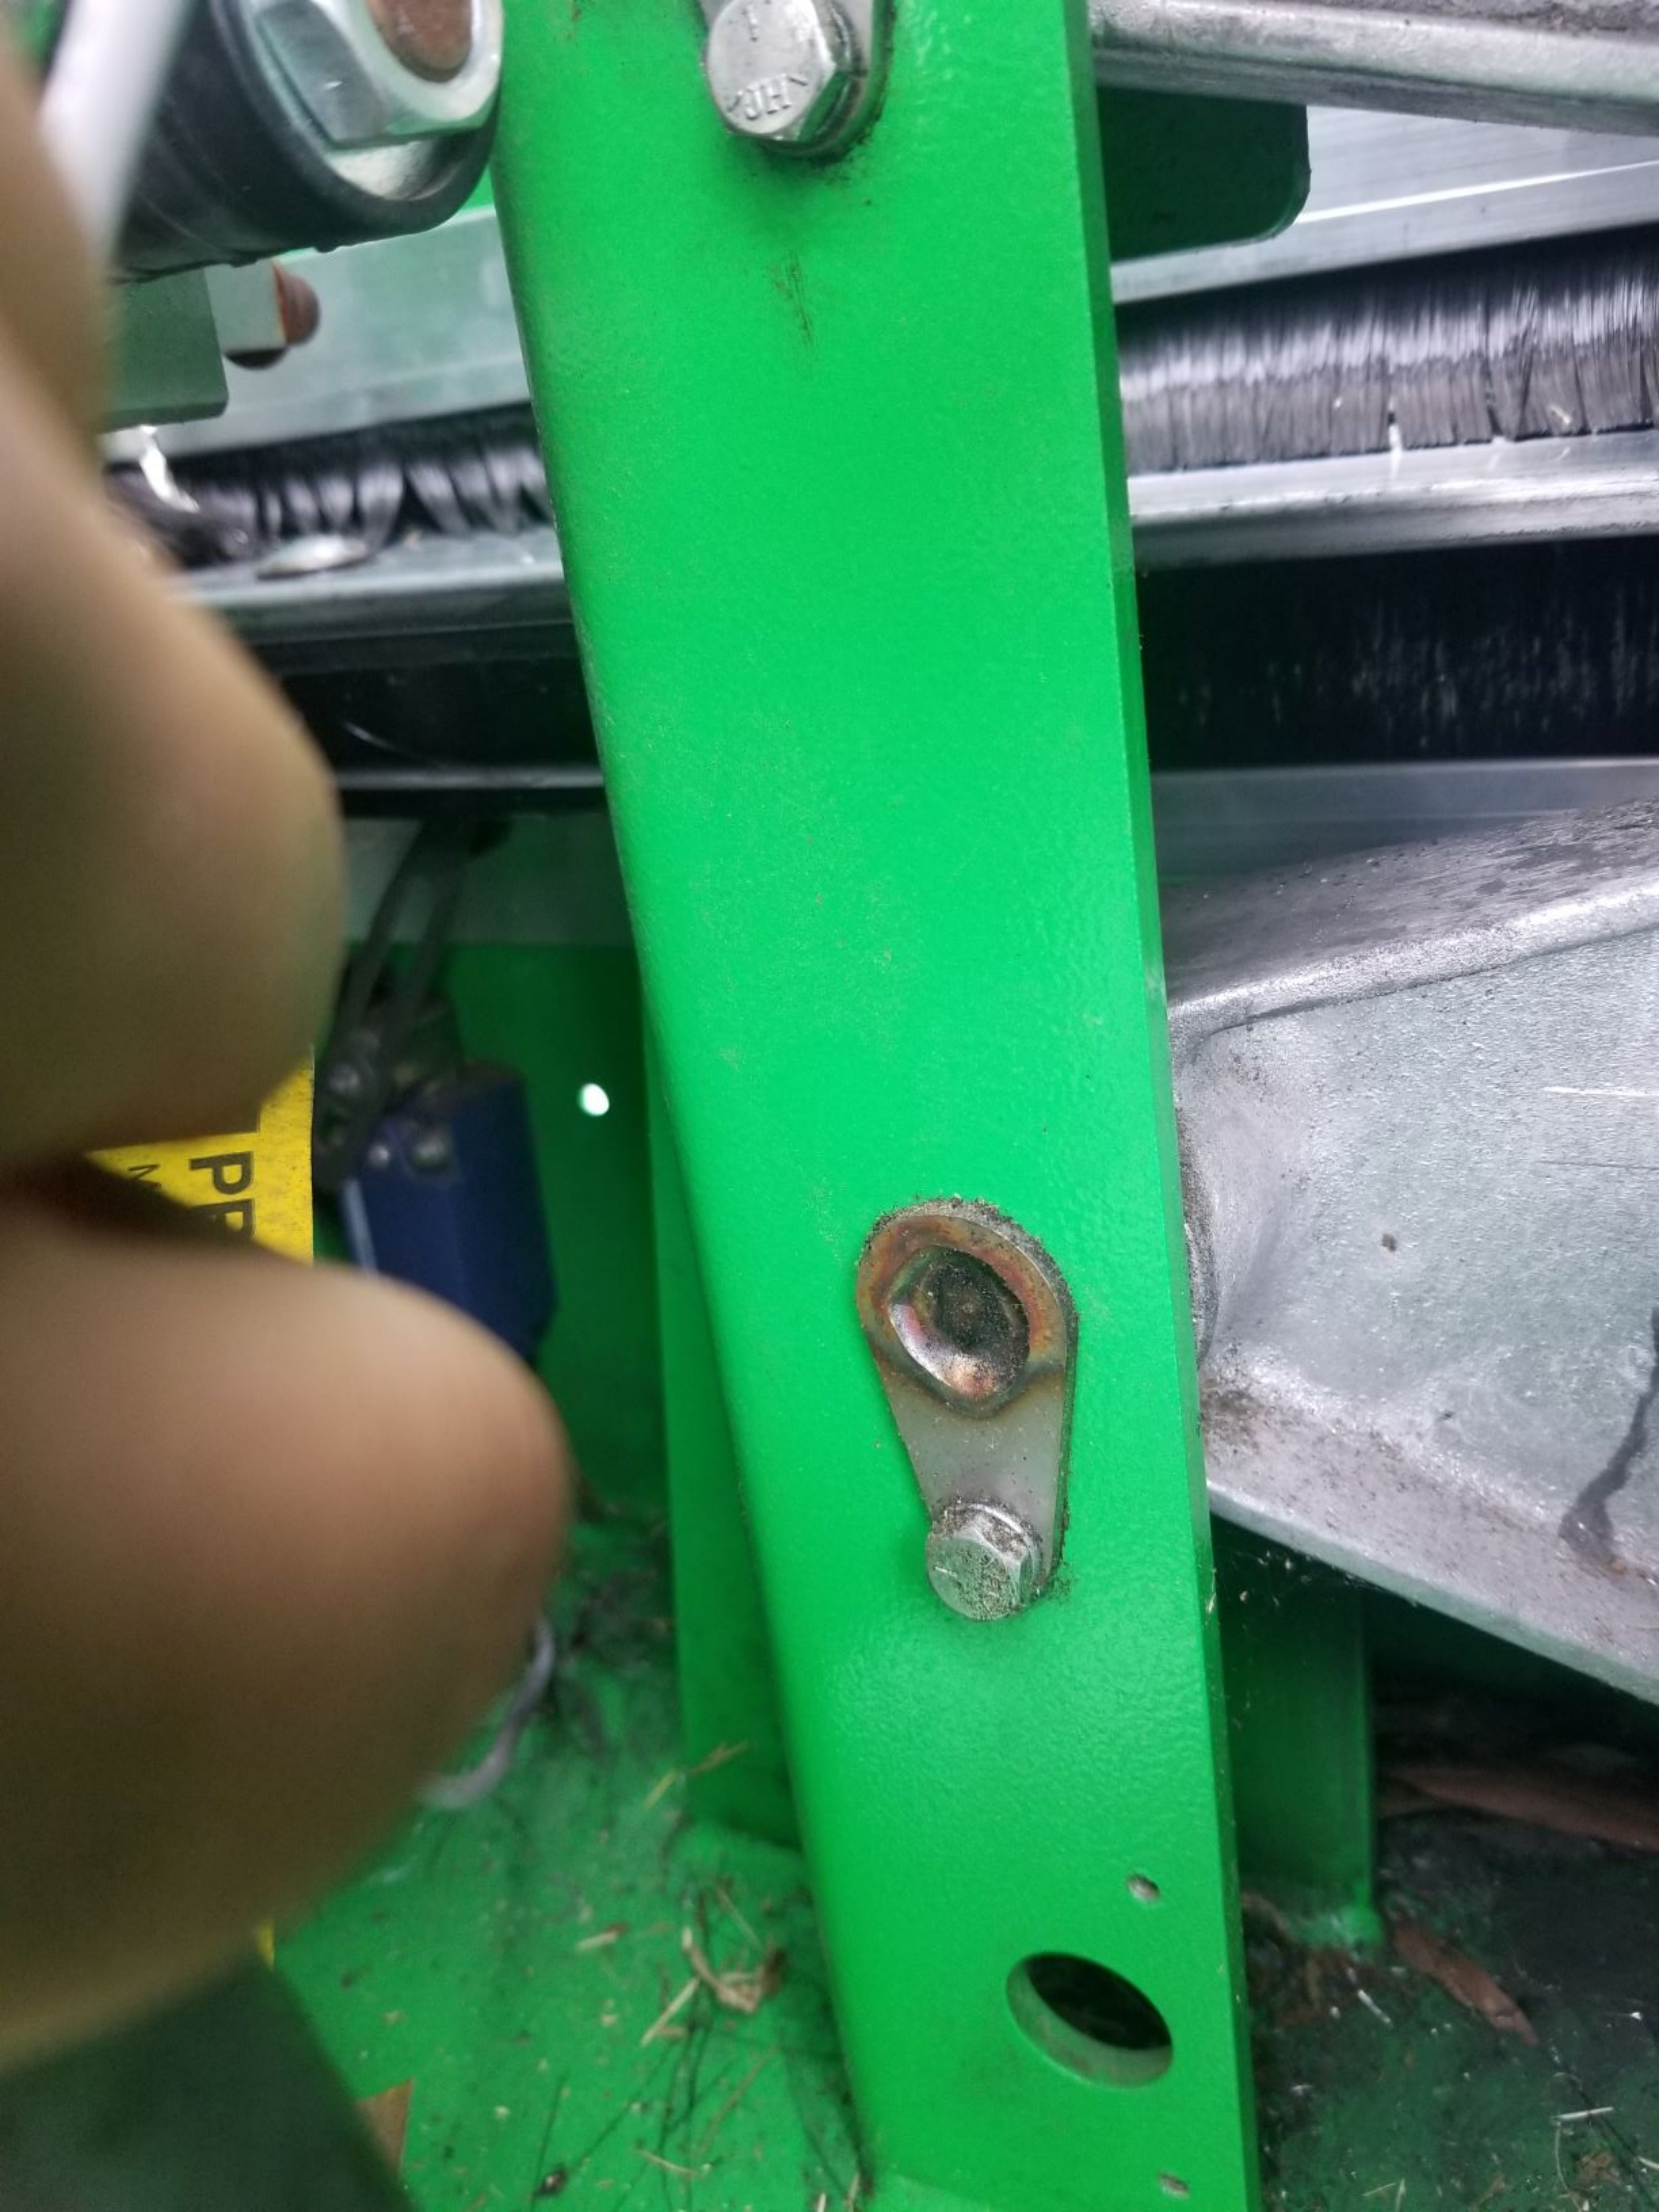




DELTA POWER
PDS24 24VDC

UTION

1838377 MS2
DMS 209
MS209

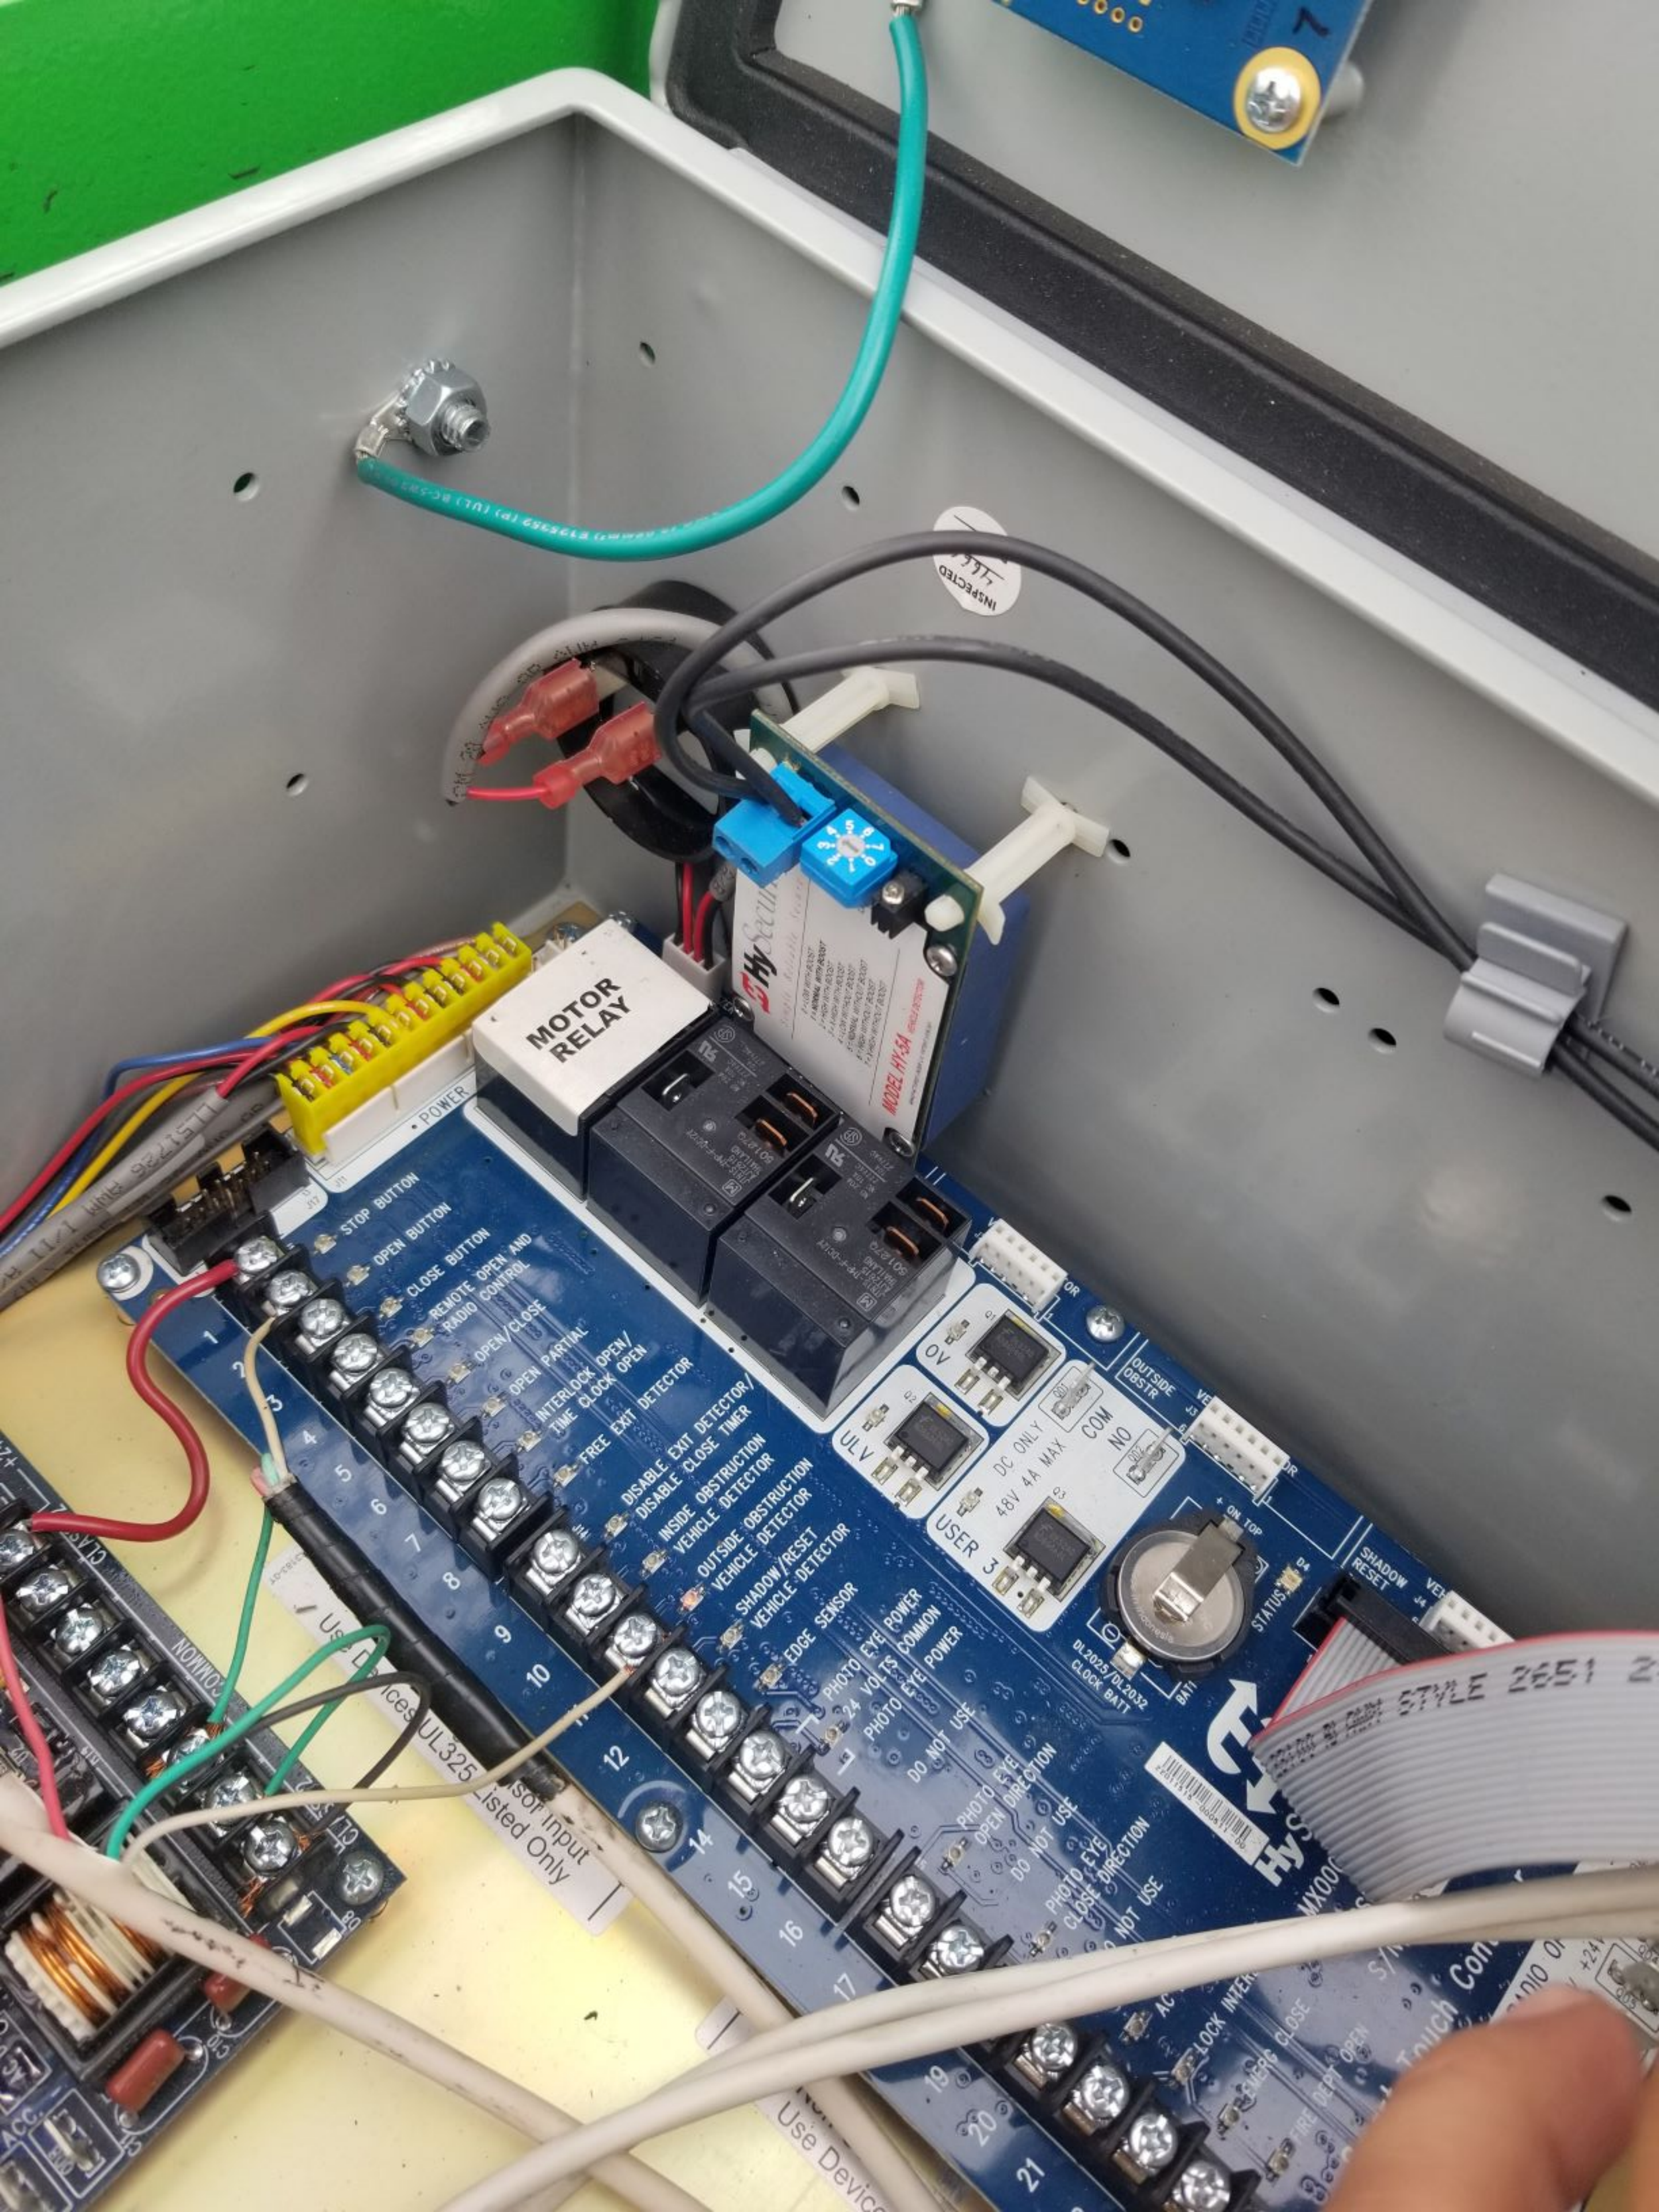

INSPECTED

MOTOR RELAY

HySecurity
MODEL HY-54

STOP BUTTON
OPEN BUTTON
CLOSE BUTTON
REMOTE OPEN AND
RADIO CONTROL
OPEN/CLOSE
OPEN PARTIAL
INTERLOCK OPEN/
TIME CLOCK OPEN
FREE EXIT DETECTOR
DISABLE EXIT DETECTOR/
DISABLE CLOSE TIMER
INSIDE OBSTRUCTION
VEHICLE DETECTOR
OUTSIDE OBSTRUCTION
VEHICLE DETECTOR
SHADOW/RESET
VEHICLE DETECTOR
EDGE SENSOR
PHOTO EYE POWER
PHOTO EYE COMMON
PHOTO EYE POWER
DO NOT USE
PHOTO EYE
OPEN DIRECTION
DO NOT USE
PHOTO EYE
CLOSE DIRECTION
DO NOT USE
AC
LOCK INTER
EMERG CLOSE
FIRE DEPT OPEN
Touch Con

STYLE 2651 2

Use Device

